

## SERVICE BULLETIN

No	
	lact ALL ELECTRONIC FLIPPERS
Effective	IMMEDIATELY
то:	SERVICE/PARTS MANAGERS

A. Attached is an assembly drawing of a BALLY electronic flipper. It shows two new assemblies: the SP-200-212 spring and the A3714-3 plunger and link assembly.

These are designed to  $\underline{\text{REPLACE}}$  the  $\underline{\text{SP200-211}}$  spring and the  $\underline{\text{A3714-2}}$  plunger and link assembly.


The addition of these components is the recommended method for correcting flipper hang-up on some electronic games.

B. The thumper bumper skirt assembly C790 has been changed to a stronger nylon material to prevent breakage.

This new skirt is available under the same part C790.

C. Also attached is a typical playfield wiring diagram for an electronic flipper game, with the addition of a one Amp-slow blow fuse in the solenoid circuit.

This fuse is in series with the 43 volt line to all playfield solenoids except the flippers.

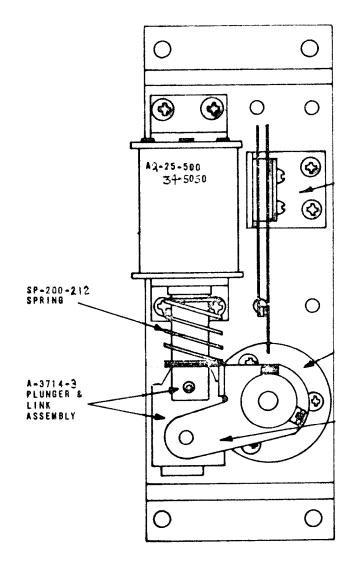

ASE1587-101 FLIPPER UNIT

