



DATA EAST PINBALL, INC.

SERVICE BULLETIN

MAY 27, 1988

Game: Secret Service

#009

Subject: Flipper end of stroke switch actuator

Problem: The heat shrink tubing covering the flipper end of stroke switch actuator wears down prematurely. This results in metal to metal contact between the actuator and the blade of the switch which will cause premature switch wear.

Solution: Enclosed are 50 new end of stroke switch accuator caps. It is a thicker more wear resilient material, and when it does wear down you can turn it 45° and its now striking the end of stroke switch with a different surface. Please pass these out to your customers that have purchased Secret Service games.

Note: Make sure you seat the cap completely. Failure to do so will result in the cap either hanging up on the short blade of the E.O.S. or on the flipper coil bracket.

Pete Gustafson
Field Service Manager
Data East Pinball, Inc.